



151 Garrison Oak Dr.
 Dover, DE 19901
 (302) 674-8405

Protected Property

Name: Eden Hill Medical Center
 Address: 200 Banning Street
 Dover DE 19904
 Contact: Randy Hagen
 Phone 302-538-0230
 Email: Rhagen@edenhillmc.com

**FIRE ALARM SIGNALING SYSTEM
 ANNUAL CERTIFICATION OF
 INSPECTION**

Fire Alarm Signaling System Company's Certification

Company Name: ADVANTECH License #: FAL 0123
 The fire alarm signaling system company certifies that the features of the system, as indicated herein, were tested, inspected, and/or maintained in accordance with the Delaware State Fire Prevention Regulations
 Print Name : Ehart/Bender Title: INSPECTOR
 Signature : _____ Date: 07/28/2023

Type of Alarm Signaling System

System ID #: 895-0237
 Local Auxiliary Remote Station Proprietary
 Emergency Voice Detection Central Station Household

Power Supply Systems

Primary: Dedicated Yes No* N/A* Locked Out? Yes No*
 Secondary: Battery Amp Hour Rating See Below Tested OK? Yes No*
 Secondary: Battery Amp Hour Rating _____ Tested OK? Yes No*
 Secondary: Battery Amp Hour Rating _____ Tested OK? Yes No*

Control Unit

System #1 Manufacturer: Notifier Model #: NFS-300 Communicator Type: _____
 Hardwired: Multiplex: Addressable: Other(Specify):

Device/Equipment	System Total	Number Tested	Deficiencies*	Remarks
Lamps & LEDs	12	12	0	
Fuses				
Trouble Signals	1	1	0	
Zone Disable				
Supervisory Signals	1	1	0	
Ground Fault				
Transmission Off Premises	2	2	0	
Communication Path 1				
Communication Path 2				

Alarm Initiating Devices				
Device/Equipment	System Total	Number Tested	Deficiencies*	Remarks
Manual Pull Stations	13	13	0	
Heat Detectors	7	7	0	
Smoke Detectors	37	37	0	
Duct Detectors	8	8	0	
Water Flow Devices				
Tamper Switches				
Other (Specify):				
Other (Specify):				


Alarm Indicating Devices				
Device/Equipment	System Total	Number Tested	Deficiencies*	Remarks
Bells	1	1	0	
Horn/Strobes	105	105	0	
Speaker/Strobes				
Mini-Horns/Horns				
Strobes	25	25	0	
Speakers				
Remote Microphone Ann				
Remote Annunicator	2	2	0	
Other (Specify):				
Other (Specify):				
Other (Specify):				
Other (Specify):				

Comments/Deficiencies

FACP. 2X18A. 100/100 NAC. 2X7A. 100/100. 3rd Floor Rm 330
 NAC. 2X7A. 100/100 NAC. 2X7A. 100/100. 3rd Floor
 NAC. 2X7A. 100/100. NAC. 2X7A. 100/100 Surgical IT Room
 Dialer. 1X7A. 100
 NAC. 2X7A. 100/100. 2nd floor
 NAC. 2X7A. 100/100. 2nd floor
 NAC in Room 330 & 2005
 Suite 380 Bathroom no Strobe

Hall By room 310 not flashing
 Smoke Dectectors in the Endo room, Anesthesiology room, and the supply closet are too close to the defuser
 Sterile Supplies room X 2 S/D, Anesthesia work room X 1,
 Dectectors in the Endo room, Anesthesiology room, and the supply closet are too close to the defuser

H/S10-7 and H/S10-8 not activating in lifestance health hallway 2nd floor room 260. Hallway. 2nd notice Suite 130 strobe blocked by shelf

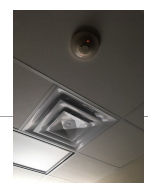



**Office of the State Fire Marshal
Fire Protection System(s)
Annual Certificate of Inspection**



OWNER OF THE PROPERTY

Name: Eden Hill Medical Center Owner's Address: 200 Banning St
Dover DE 19904

BUILDING/FACILITY

Name: Eden Hill Medical Center Address of the Building: 200 Banning St
Dover DE 19904

TENANT / OCCUPANT

Name: Eden Hill Medical Center Address: 200 Banning St Phone: Randy Hagon
Dover DE 19904 Contact: 302-538-0230
Dover

Annual Certificate of Inspection Report of a MAJOR deficiency (other than Annual Inspection)

DATE OF INSPECTION 7/28/2023

FIRE PROTECTION SYSTEM INFORMATION

Licensed Company Name: Advantech License #: 0123

(for Water- Based systems) Inspector's Name: _____ Certificate #: WBC -

SYSTEM TYPE:

- Fire Alarm
- Automatic Sprinkler:
 - Wet Sprinkler Dry Sprinkler Pre-Action Deluge Water Spray Other
- Commercial Cooking
- Special Hazard:
 - HALON, Clean Agent, INERGEN, FM-200 Carbon Dioxide Dry Chemical Foam Other
- Standpipe:
 - Wet Standpipe Dry Standpipe Other

SYSTEM ID: 895-0237 SYSTEM LOCATION: Main Electrical Room

MAJOR DEFICIENCIES IDENTIFIED DURING INSPECTION? YES (if so, describe below) NO

COMMENTS/DEFICIENCY DESCRIPTION

Dectectors in the Endo room, Anesthesiology room, and the supply closet are too close to the defuser
H/S10-7 and H/S10-8 not activating in lifestance health hallway 2nd floor room 260. Hallway. 2nd notice Suite 130 strobe blocked by shelf

The State Fire Prevention Regulation 703, Chapter 1, §4.1.5 mandates that Annual Certificates of Inspection be submitted to the Office of the State Fire Marshal by the licensed company within thirty (30) days of the completion of the required annual inspection.